
## powermax451\*

## T45m machine torch assembly

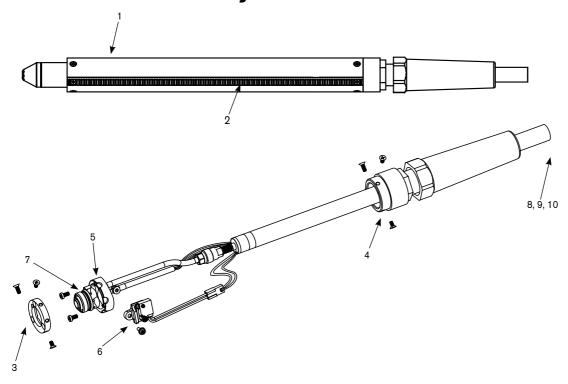

**Assembly** 

Assembly		
	Part number	Description
	088010*	T45m machine torch assembly with 7.6 m (25') leads
	088011*	T45m machine torch assembly with 10.7 m (35') leads
	088012*	T45m machine torch assembly with 15.2 m (50') leads
1.	228228	Kit: T45m positioning sleeve
2.	228229	Kit: T45m removable gear rack
3.	228322	Kit: Front mounting ring
4.	228323	Kit: Rear mounting ring
5.	228320	Kit: T45m torch body replacement
6.	228321	Kit: T45m cap-sensor switch replacement
7.	058503	O-ring: torch body
8.	228317	T45m torch lead replacement, 7.6 m (25')
9.	228318	T45m torch lead replacement, 10.7 m (35')
10.	228319	T45m torch lead replacement, 15.2 m (50')
	128650	On/Off pendant for machine torch, 7.6 m (25')
	128651	On/Off pendant for machine torch, 15.2 m (50')
	128652	On/Off pendant for machine torch, 22.8 m (75')
	228300	Work lead with clamp, 6.1 m (20')
	228307	Work lead with clamp, 15.2 m (50')

 $<sup>{}^{\</sup>star}\!Assembly includes consumables.$